

# **SERVICE BULLETIN**

**SB00033** 

Rev A

Page 1 of 2

### **Cub Crafters, Inc. Considers Compliance Mandatory**

This Service Bulletin is issued per the requirements of ASTM F3198-18. It is a Safety Directive for the purpose of compliance with 14 CFR §91.327(b)(4).

**EFFECTIVE DATE:** This Service Bulletin is effective **November 25, 2024.** 

**SUBJECT**: AFT SEAT INSPECTION

MODELS AFFECTED: CC11-0001 THROUGH CC11-0430 EQUIPPED WITH AN AFT SLING SEAT.

**COMPLIANCE TIME:** REQUIRED AT NEXT ANNUAL INSPECTION.

**PURPOSE:** To inspect the condition of the aft sling seat stitching, and add additional

reinforcement stitching if needed.

**WARRANTY:** Aircraft under warranty will receive the sling seat repair at no cost.

PARTS LIST: N/A

#### **INSTRUCTIONS:**

1. Read all instructions before beginning any work.

- 2. Remove the bottom portion of the aft sling seat by disconnecting the two cinched nylon straps from the floorboard, removing the cross bar from the fuselage slots, and sliding the sling seat off of the cross bar (reference the applicable AMM).
- 3. Inspect the stitching on the underside of the cross bar straps (Figures 1 and 2). Inspect for any loose or missing stitches. There should be a minimum of 6 stitches per inch (Figure 3) across the length of the sling seat.



FIGURE 1 – Aft Sling Seat



# **SERVICE BULLETIN**

SB00033

Rev A

Page 2 of 2

### **Cub Crafters, Inc. Considers Compliance Mandatory**

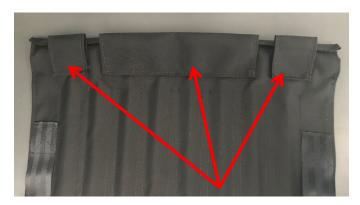


FIGURE 2 – Aft Sling Seat Seam, Bottom View



FIGURE 3 - Six Stitches Per Inch

- **4.** If no loose or missing stitches are found, reinstall the aft sling seat (reference the applicable AMM), and skip to step 7.
- **5.** If any loose or missing stitches are found, remove the sling seat from the aircraft by loosening the top straps from the slide connectors. Contact Cub Crafters customer service department for an RMA number at:

Cub Crafters, Inc. 1918 S. 16<sup>th</sup> Avenue Yakima, WA 98903. 1-509-248-9491 or 1-877-484-7865 support@cubcrafters.com

- **6.** The seat will be repaired at Cub Crafters, and returned once repaired. Upon receipt of the repaired sling seat, install in the aircraft (reference the applicable AMM).
- **7.** Make logbook entry stating that SB00033 Rev A was complied with. There is no change to weight & balance.

If you are no longer in possession of this aircraft, please forward this information to the present owner/operator and notify Cub Crafters, Inc. Contact the customer service department at:

Cub Crafters, Inc. 1918 S. 16<sup>th</sup> Avenue Yakima, WA 98903. 1-509-248-9491 or 1-877-484-7865 support@cubcrafters.com

Please include the aircraft registration number, serial number, current name, and address of the owner and/or operator.