

NB00006

Page 1 of 2

EFFECTIVE DATE:	This NOTIFICATION is effective May 19, 2023
SUBJECT:	Oil Filter Defect
APPLICABLE MODELS:	CC11-100 Aircraft
COMPLIANCE TIME:	As Required
PURPOSE:	Cub Crafters has been made aware of a single installation where the threads of the oil filter were not normal to the sealing face. This defect from the manufacturer can result in an uneven and unreliable seal. This notification is to inform owners of the potential issue and provide instructions to verify a proper installation on their aircraft.

INSTRUCTIONS:


1. Remove upper cowl to verify if an oil filter is installed, as not all CC11-100's are equipped with this filter. It will be located on the aft side of the engine on the left side.



- **2.** If you have no oil filter here, then this notification is not applicable to your aircraft and the upper cowl may be reinstalled.
- **3.** If you do have an oil filter here, inspect the interface between the filter and filter adapter. The interface should be consistent and even around the entire perimeter.



NB00006

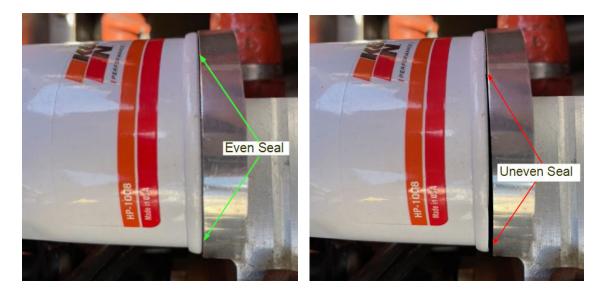

 If the perimeter does not have an even seal, your oil filter must be replaced with a new SP56002-002 filter before next flight. You can order a replacement filter <u>online</u>, or contact the Cub Crafters store.

509-367-5201 parts@cubcrafters.com

If you are no longer in possession of this aircraft, please forward this information to the present owner/operator and notify Cub Crafters, Inc. of the address of the current owner to:

Cub Crafters, Inc. 1918 S. 16th Avenue Yakima, WA 98903. 1-509-248-9491 <u>support@cubcrafters.com</u>

Please include the aircraft registration number, serial number, current name, and address of the owner and/or operator.