

Cub Crafters, Inc. Considers Compliance Mandatory 11/12/2010

EFFECTIVE DATE:	This SAFETY ALERT is effective May 05, 2009		
SUBJECT:	Corrosion Potential		
MODELS AFFECTED:	CC11 S/N 00001 thru S/N 00099, excluding S/N 00095		
COMPLIANCE TIME:	Replace at Next Maintenance Action		
PURPOSE:	Replacement of the three (3) empennage wire brace attachment brackets.		
PARTS LIST:	PART NUMBER	DESCRIPTION	REVISION
	SC81206-001	Vertical Stabilizer Wire Attach	D or Higher
	SC81007-001	Horizontal Stabilizer Wire Attach, Left	G or Higher
	SC81007-002	Horizontal Stabilizer Wire Attach, Right	G or Higher



FIGURE 1 – Corroded Parts

Cub Crafters, Inc. Considers Compliance Mandatory 11/12/2010

PART REPLACEMENT

1. Contact Cub Crafters Customer Support for replacement parts SC81206-001 (Revision D or higher), and SC81007-001 and SC81007-002 (Revision G or higher). When replacement is performed, follow the Maintenance Manual Section 6.3.5 "Empennage" for proper rigging and tensioning of wires.
2. Make log book entries identifying replacement parts and their revision levels (Part Number and Revision level are noted on part sticker).
Example: "Original SC81206-001, SC81007-001 and SC81007-002 have been replaced with SC81206-001 Rev. E, SC81007-001 Rev. H, and SC81007-002 Rev H per Safety Alert SA0006."

**This Safety Alert was initially released on May 5, 2009. It required only the inspection and, if deemed necessary, replacement of brackets. Parts replaced at that time satisfies this Service Alert and requires no further action. Any brackets not replaced per the initial release or Revision A release must be replaced at the next maintenance action.*

Regardless of whether the parts were replaced in compliance with the initial release or Revision A, this Safety Alert has been satisfied when aircraft is equipped with all three brackets at the indicated revision levels.

NOTE:

Even as brackets are replaced, the brackets and wire condition and tension have been and will continue to be inspection areas during all Pre-Flight and Condition Inspections.

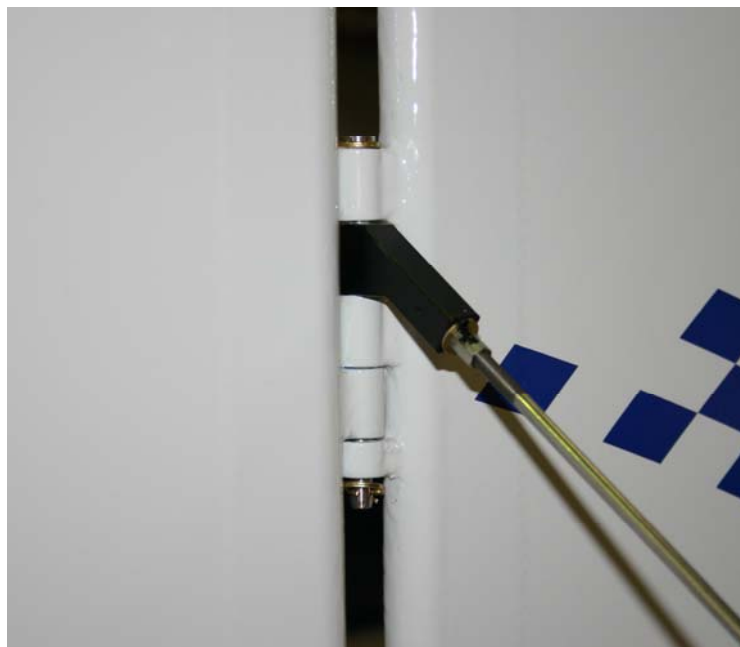


FIGURE 2 - Upper Wire Attach

Cub Crafters, Inc. Considers Compliance Mandatory

11/12/2010

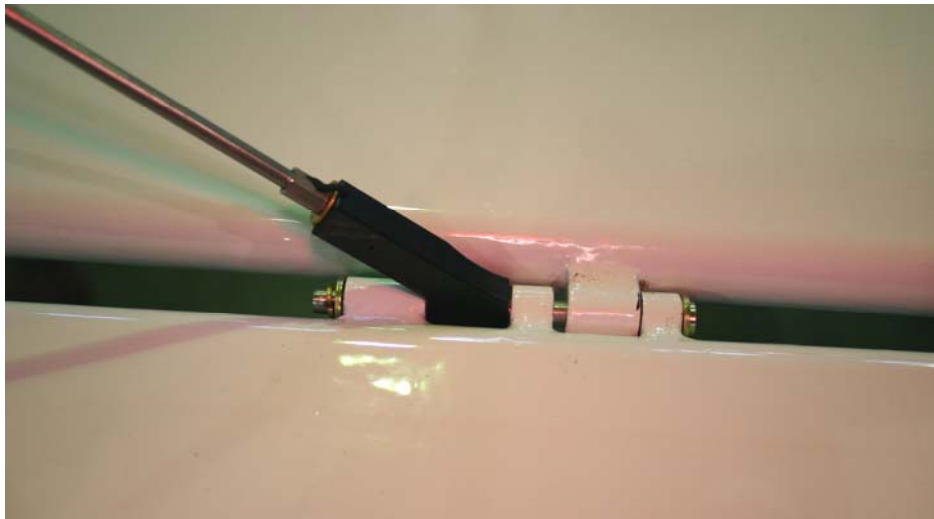


FIGURE 3 - Lower Wire Attach

If you are no longer in possession of this aircraft, please forward this information to the present owner/operator. Notify Cub Crafters, Inc. of the current owner's address. Contact the customer service department at:

Cub Crafters, Inc.
1918 S. 16th Avenue
Yakima, WA 98903

Toll Free Number: (877) 484-7865 or e-mail support@cubcrafters.com

Please include the aircraft registration number, serial number, and the name and address of the current owner/operator.